



Solder Reflow Failures in Electronic Components during Manual Soldering

Alexander Teverovsky, Chris Greenwell,
Frederick Felt

Perot Systems/NASA GSFC, code 562,
Parts, Packaging, and Assembly Technologies Office
Alexander.A.Teverovsky.1@gsfc.nasa.gov

Purpose and Outline

Purpose:

To discuss specifics of manual-soldering-induced failures in plastic devices with internal solder joints.

Outline:

- ☐ Failures of power transistors
- ☐ Failures of temperature sensors
- ☐ Failures of 3D-Plus EEPROM
- ☐ Conclusion



Failures of Power FETs


- ☐ Three power FETs in plastic surface mount packages (D2Pak) failed short circuit after manual soldering onto a board.
- ☐ The parts passed screening including 100% C-SAM inspection.
- ☐ Failed parts had top-of-die delaminations.



X-ray view



Typical C-SAM images

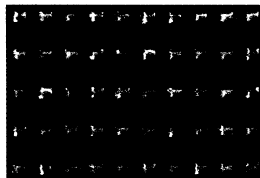

C-SAM of failed part



CMSE'08




GSFC Parts Analysis Laboratory

3

Failure Analysis

- ☐ Molten solder squeezed up to the die surface along the die-molding compound interface.
- ☐ The dice were not protected with glassivation allowing solder to short gate and source to the drain contact.

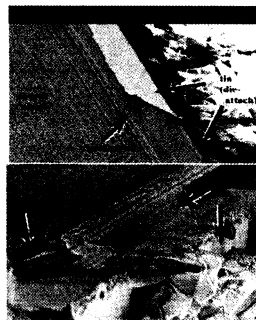

Conclusion: the parts failed due to overheating during manual soldering.

CMSE'08




GSFC Parts Analysis Laboratory

4


Possible Failure Mechanisms

Molten solder does not wet glass/ceramic/plastic and should be pressed to flow in a gap by internal or external forces.

- Internal force: compressive stresses develop if expansion of solder > expansion of MC.

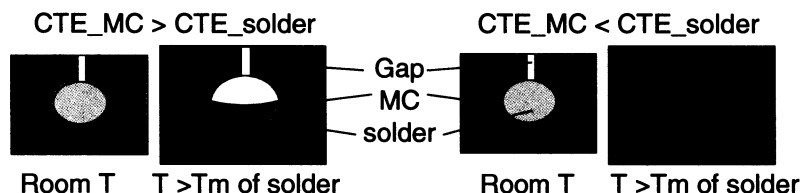

- An external force during soldering might result in molten solder filling the gap even at $CTE_{MC} > CTE_{solder}$.

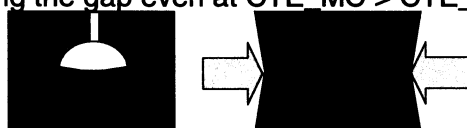

CMSE'08



GSFC Parts Analysis Laboratory


5

Thermo-Mechanical Characteristics of Package Materials

Deformation vs. temperature was measured on MC, transistors, and with a probe installed on a die (after decapsulation).

Average TMA characteristics

	T _g , °C	CTE1, ppm/K	CTE2, ppm/K
MC	163	21.5	65
Package	165	23	70

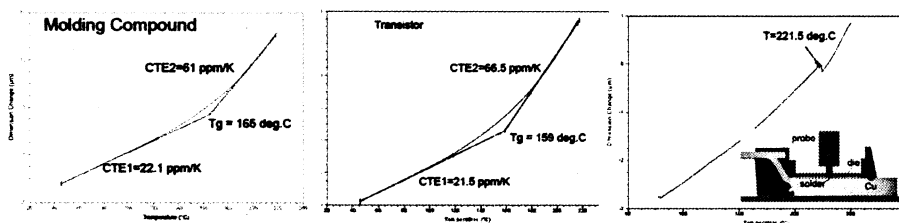

Probe-on-a-die measurements confirmed that a high-temperature Sn/Ag solder with $T_m = 221^\circ\text{C}$ was used to mount die to heat spreader.

CMSE'08




GSFC Parts Analysis Laboratory


6

Temperature Deformations in Solder

Available literature data on solder expansion were used for best-fit estimations of CTE and density at $-65 < T < 450$ °C.

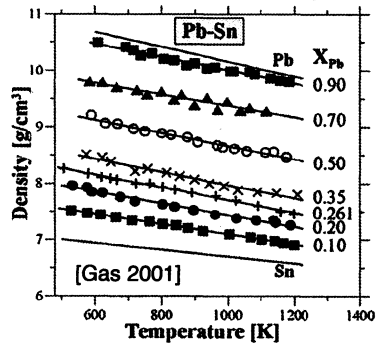

Molten near-eutectic solder has
CTE = 34.5 ppm/K.

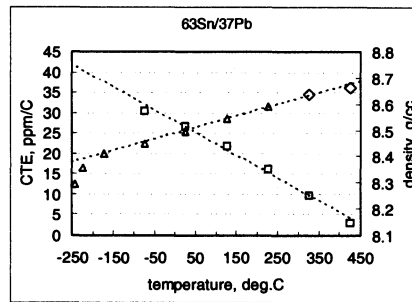

$$CTE = 0.0285 \times T + 24.93$$

$$\rho = 9 \times 10^{-4} \times T + 8.53$$

where CTE is in ppm/K, ρ in g/cc, T in °C

CMSE'08




GSFC Parts Analysis Laboratory

7


Delamination During Soldering

A size of MC/die gap, ΔY , was calculated assuming that at RT $\Delta Y=0$ and adhesion is negligible.

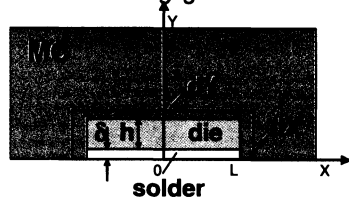

Compressive stresses ($\Delta Y < 0$) might occur at very thick layers of solder ($\delta \sim 1$ mm) only.

$$\Delta Y = \int_{T_0}^T [(h + \delta) \times CTE_{MC} - h \times CTE_{die} - \delta \times CTE_s] dT$$

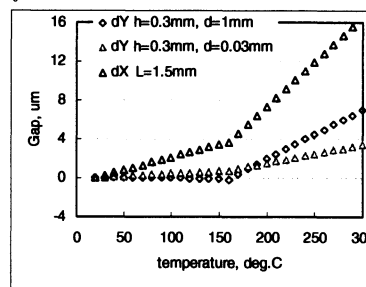

- ☐ Heating of the package uniformly creates enough room for solder expansion and no reflow failures should occur.
- ☐ Power FETs are designed for SMT for oven reflow soldering at $T \sim 250$ °C (up to 30 sec.), which exceeds $T_m = 221$ °C.
- ☐ Heating to melting temperature is a necessary but not a sufficient condition for reflow failures.


CMSE'08



GSFC Parts Analysis Laboratory

8

Most Probable Cause of Failure

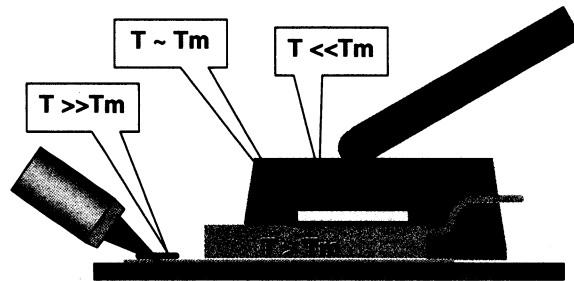

- ☐ Manual soldering caused fast heating of the copper heat sink while MC remained cool thus forcing molten solder to create and fill top-of-die delamination.
- ☐ Fixing a part on a board by applying a force to the package increases the probability of failure.

CMSE'08




GSFC Parts Analysis Laboratory

9

Solder Reflow Failures of Thermistors

Thermistors per 311P18-02T-7R6 passed resistance to soldering heat test MIL-STD-202, TM210.

- ☐ Case A: failed during board-level testing.
- ☐ Case B: failed after rework on the adjacent microcircuit.
- ☐ FA: short is due to solder reflow caused by overheating.

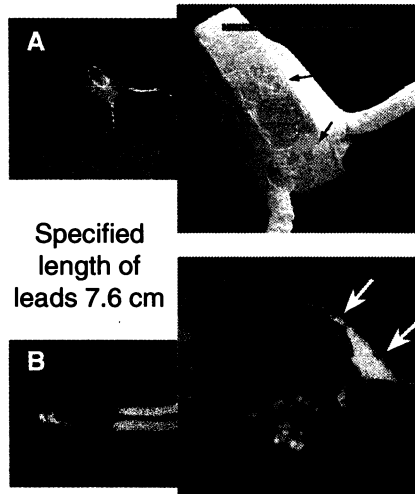

CMSE'08



GSFC Parts Analysis Laboratory

10

Effect of Wire Length

Temperature distribution along a wire of diameter d and length l

$$\frac{\partial^2 T}{\partial x^2} = \alpha^2 \times T \quad \alpha = \sqrt{R_t \times G_t}$$


thermal resistance per unit length:

$$R_t = \frac{4}{\lambda \times \pi \times d^2}$$

thermal conductance per unit length:

$$G_t = d \times \frac{\lambda_{air}}{l} \times C_1 \times (a \times l^3 \times \Delta T)^n$$

Solution: $T(x) = T_o \times e^{-\alpha x}$

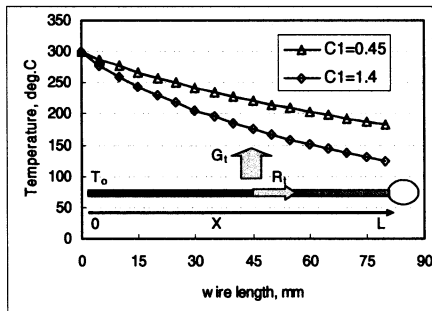

- ☐ At specified conditions a soldering iron is set to $T_o = 300^\circ\text{C}$ and at $L = 76\text{ mm}$ $T_{\text{sensor}} < 180^\circ\text{C}$ (no melting).
- ☐ Cutting leads to ~1" will increase T_{sensor} to 220 to 250 $^\circ\text{C}$ and might cause solder reflow failures.

CMSE'08



GSFC Parts Analysis Laboratory


11

Mechanism of Failure

Case A:


Short Cu wire quickly transfers the heat to one side of the sensor forcing molten solder to expand and squeeze between cold MC and die.

Holding a sensor with tweezers increases the probability of short circuit.

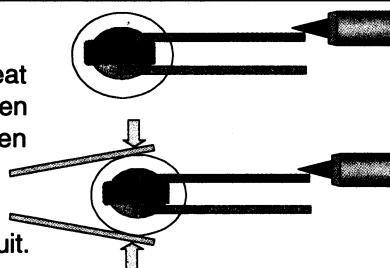

Case B:

A touch with a soldering iron creates temperature gradient allowing solder melting on one side while other side remains cool.

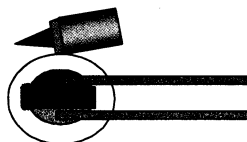

CMSE'08







GSFC Parts Analysis Laboratory

12

3D-plus Memory Failure

- ❑ The part passed all screening and qualification testing but failed with a short circuit between internal power supply lines after manual soldering onto a board with a soldering iron set to 700 F (371 °C).
- ❑ The part is comprised of 8 micro-boards with a TSOP memory microcircuit and ceramic capacitor across power supply line. Interconnections are made on the boards and externally, via package metallization (8 μm Au/Cu/Ni).
- ❑ How to pinpoint location of the defect?

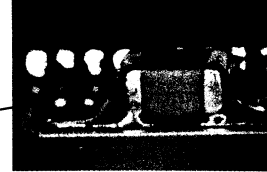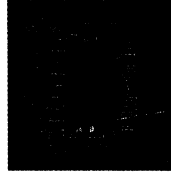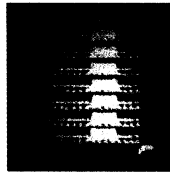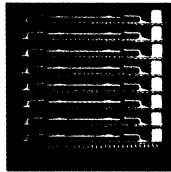

CMSE'08



GSFC Parts Analysis Laboratory

13

Magnetic Current Imaging with SQUID

- ❑ MCI with a superconducting quantum interference device (SQUID) probe (NEOCERA) was used to locate the defect.
- ❑ Maximum current of 2.7 mA, 5333 Hz, was applied to the sample.
- ❑ The technique allows for current density mapping by scanning magnetic field at a distance from the surface ~ 100 μm .
- ❑ SQUID is effective to depth of several millimeters.



CMSE'08




GSFC Parts Analysis Laboratory

14

Location of Short Circuit

- Results of MCI indicated the short through a ceramic capacitor on the top board inside 3D-plus cube.

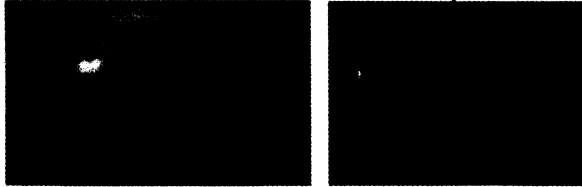

- Two plane X-section showed that the failure was due to reflowed solder short at the top surface of the capacitor.



CMSE'08




GSFC Parts Analysis Laboratory

15

Conceivable Causes of Failure



- Overheating during soldering (soldering iron was set to 371 °C).*
Experiment showed that possible T rise does not exceed 80 °C.

Soldering simulation.

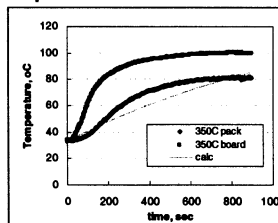

Experimental (marks) and calculated (line) temperature variations. The soldering iron was fixed at the middle of contact pads.

- Overheating during baking in the oven.*
Analysis did not reveal differences in microstructure of solder in 8 boards (no solder coarsening or variations in thickness of IMC layers).

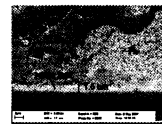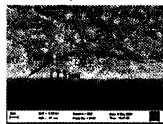

CMSE'08




GSFC Parts Analysis Laboratory



16

How Hot is a Soldering Iron?

- Temperatures of a soldering iron were set to 200, 250, 300, 350, and 400 °C.



- IR measurements in 5 points were used to get temperature distributions.

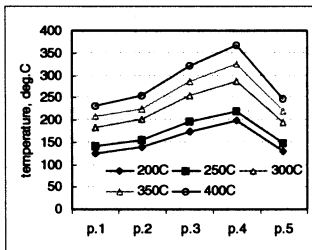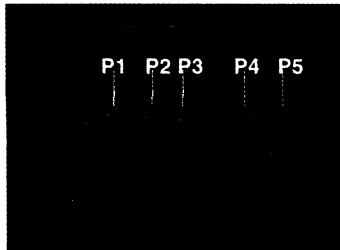

Temperature of the holder near the tip (P3) is only 10% to 13% lower than T_{max} .

CMSE'08



GSFC Parts Analysis Laboratory


17

Most Probable Cause of Failure

- The response of semi-infinite solid to surface temperature rise to T_s can be described with the Gaussian error function:


$$\frac{T - T_i}{T_s - T_i} = \operatorname{erfc}\left(\frac{x}{(4\alpha t)^{0.5}}\right)$$

- Temperature distributions were calculated at $T_s = 350$ °C and thermal diffusivity, $\alpha = 4.3E-7$ m/s².

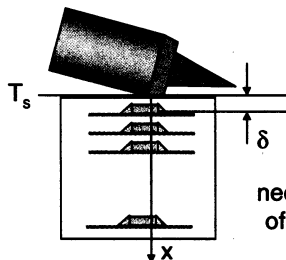

Only ~0.5 sec is necessary to reach T_m of solder (~183 °C) at the top board

T distributions across 3D-plus package

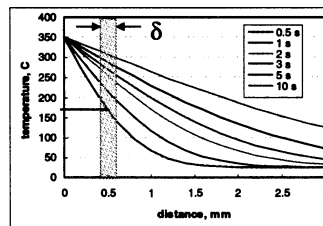

The most probable cause of failure is inadvertent touch by a soldering iron.

CMSE'08



GSFC Parts Analysis Laboratory

18

Conclusion

- ☐ Reaching melting point of solder is a necessary, but not a sufficient condition for internal reflow failures in plastic encapsulated devices.
- ☐ Fast heating during manual soldering allows plastic encapsulation to remain at relatively low temperatures, so the die stays under compressive stresses. Expansion of solder might cause delamination and spreading of molten solder along the surface of the die resulting in short circuit failures.
- ☐ Preheating and equalizing temperature across the package might reduce the probability of failures.
- ☐ Temperature of soldering iron holder near the tip might be much higher than melting temperature of solder. Occasional touch to the surface of the package might cause failures.
- ☐ Reducing the length of wires increases die temperature. Special care (thermal shunts) should be taken to avoid solder reflow failures.
- ☐ Avoid holding or touching plastic packages during soldering.

